

MAY 19, 2025



3. ~~UNIFORM CONSTRUCTION CODE (UCC) PART I 2021 EDITION.~~
~~USE AND OCCUPANCY CLASSIFICATION: GROUP B~~
~~WORK CLASSIFICATION: REPAIR~~
~~CONSTRUCTION TYPE: 1A0~~
~~USE AND OCCUPANCY CLASSIFICATION: GROUP B~~

	GRADING		FINISHED WOOD
	NEW CONSTRUCTION		WOOD BLOCKING
	CONCRETE		TRAIL
	BRICK (ELEVATION)		GRAVEL
	BRICK (SECTION)		EARTH
	SLATE SHINGLES		
	CMU		
	STEEL		
	ROOF INSULATION		
	BATT INSULATION		
	GWB		
	PLYWOOD		

[illegible]

Figure 1 shows architectural drawing symbols. The symbols are organized into two columns. The left column includes: Detail Number (a circle with a cross), Section (a circle with a horizontal line), Building Section (a circle with a vertical line), Building Elevation (a circle with a diagonal line), Section Detail (a circle with a cross and a line), and Enlarged Detail (a circle with a cross and a line). The right column includes: Level Name (a circle with a cross), Elevation (a circle with a cross and a line), Wall Type (a circle with a cross and a line), Room Name (a circle with a cross and a line), Door Number (a circle with a cross and a line), and Window Number (a circle with a cross and a line).

[illegible]

TITLE SHEET	
ARCHITECTURAL DRAWINGS	
A1.0	SELECTIVE REMOVALS PLANS
A1.1	WINDOW SCHEDULE & DETAILS
A1.2	DOOR SCHEDULE & DETAILS
A2.0	BASEMENT & FIRST FLOOR PLANS
A3.0	SOUTH ELEVATIONS
A3.1	NORTH ELEVATIONS
A3.2	EAST ELEVATIONS
A3.3	WEST ELEVATIONS
A4.0	DETAILS
STRUCTURAL DRAWINGS	
S0.0	PROJECT INFORMATION
S1.0	FOUNDATION & FIRST FLOOR PLANS
S2.0	SECTION & DETAILS



1 SITE MAP
TLO Scale: NTS









2 LOCATION MAP
T1.0 Scale: NTS





- DR1.0

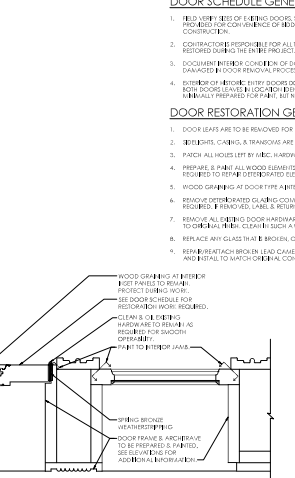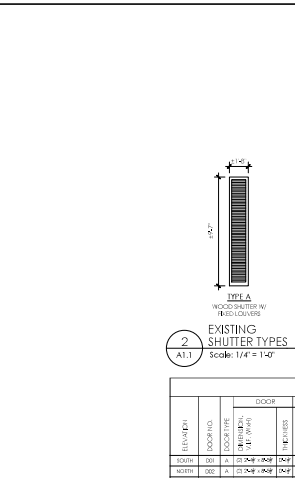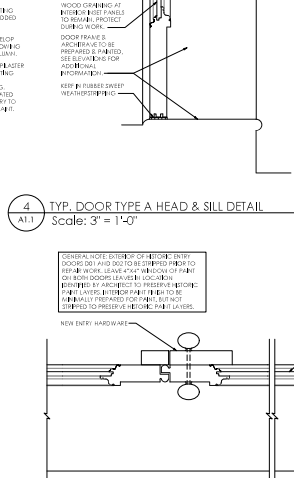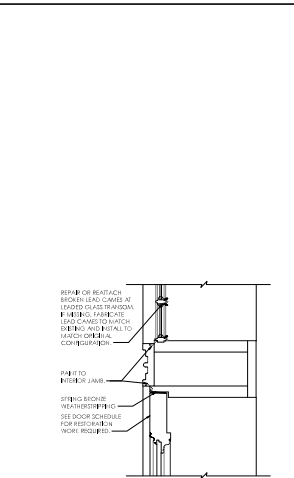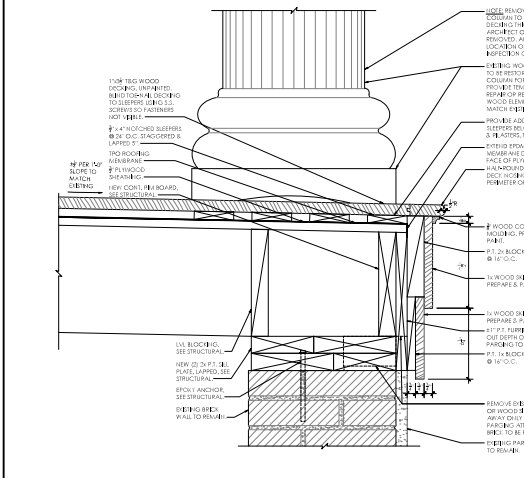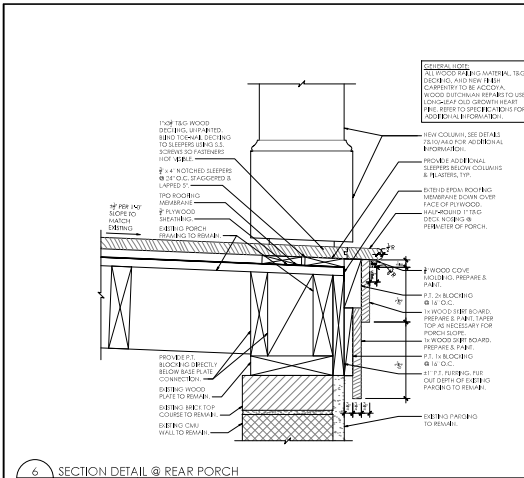


SHUTTER SCHEDULE									
LOCATION	SHUTTER NO.	SHUTTER TYPE	SHUTTER SIZE	SHUTTER MATERIAL	SHUTTER COLOR	SHUTTER FINISH	SHUTTER HARDWARE	SHUTTER NOTES	SHUTTER STATUS
10	101	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
11	102	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
12	103	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
13	104	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
14	105	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
15	106	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
16	107	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
17	108	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
18	109	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
19	110	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
20	111	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
21	112	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
22	113	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
23	114	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
24	115	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		

- SHUTTER SCHEDULE GENERAL NOTES:**
1. ALL SHUTTERS ARE TO BE RESTORED TO ORIGINAL CONDITION AND SHALL NOT BE A SUBSTITUTE FOR CONTRACTOR VERIFICATION BEFORE CONSTRUCTION.
 2. SHUTTERS ARE TO BE RESTORED TO ORIGINAL CONDITION.
 3. PATCH ALL HOLES LEFT BY SHUTTERS PREVIOUSLY REMOVED.
 4. PATCH ALL HOLES LEFT BY SHUTTERS PREVIOUSLY REMOVED.
 5. REMOVE ALL SHUTTER HARDWARE AND CAREFULLY LABEL FOR REUSE. CLEAN SHUTTER SURFACES DOWN TO ORIGINAL FINISH. AS REQUIRED FOR PATCH OR REPAIR, REPAIR OR REPLACE SHUTTER HARDWARE TO MATCH EXISTING TYPE.

DOOR SCHEDULE									
LOCATION	DOOR NO.	DOOR TYPE	DOOR SIZE	DOOR MATERIAL	DOOR COLOR	DOOR FINISH	DOOR HARDWARE	DOOR NOTES	DOOR STATUS
10	101	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
11	102	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
12	103	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
13	104	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
14	105	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
15	106	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
16	107	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
17	108	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
18	109	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
19	110	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
20	111	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
21	112	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
22	113	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
23	114	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		
24	115	A	10' x 10'	WOOD	PAINT	PAINT	PAINT		

- DOOR SCHEDULE GENERAL NOTES:**
1. ALL DOORS ARE TO BE RESTORED TO ORIGINAL CONDITION AND SHALL NOT BE A SUBSTITUTE FOR CONTRACTOR VERIFICATION BEFORE CONSTRUCTION.
 2. CONTRACTOR RESPONSIBLE FOR ALL TEMPORARY PROTECTION OF ALL OPENINGS AFTER DOORS ARE REMOVED AND RESTORED DURING THE ENTIRE PROJECT.
 3. DOCUMENT INTERIOR COVERING OF DOORS PRIOR TO WORK. CONTRACTOR TO REPAIR ANY INTERIOR FINISH DAMAGED BY DOOR REMOVAL PROCESS.

- DOOR RESTORATION GENERAL NOTES:**
1. DOOR HARDWARE ARE TO BE RESTORED TO ORIGINAL CONDITION.
 2. DOOR HARDWARE ARE TO BE RESTORED TO ORIGINAL CONDITION.
 3. PATCH ALL HOLES LEFT BY SHUTTERS PREVIOUSLY REMOVED.
 4. PATCH ALL HOLES LEFT BY SHUTTERS PREVIOUSLY REMOVED.
 5. REMOVE OPERATING GLASS COMPOUND AND INSTALL WITH GLASS COMPOUND AT ORIGINAL LOCATION.
 6. REMOVE OPERATING GLASS COMPOUND AND INSTALL WITH GLASS COMPOUND AT ORIGINAL LOCATION.
 7. REMOVE ALL SHUTTER HARDWARE AND CAREFULLY LABEL FOR REUSE. CLEAN SHUTTER SURFACES DOWN TO ORIGINAL FINISH. CLEAN UP AND PATCH ALL HOLES LEFT BY SHUTTERS PREVIOUSLY REMOVED.
 8. REPLACE ALL GLASS IN DOORS OR BROKEN DURING THE RESTORATION PROCESS WITH RESTORATION GLASS AND INSTALL TO MATCH ORIGINAL CONDITION.

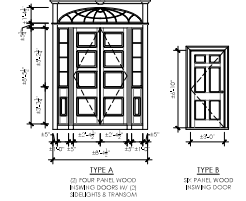

MCWB ARCHITECTS
 300 BROADWAY, SUITE 1100
 NEW YORK, NY 10013
 TEL: 212.512.1234
 FAX: 212.512.1235
 WWW.MCWBARCHITECTS.COM


CONSULTANT
 VIOLET BANK MUSEUM
 PHASE II - EXTERIOR RESTORATION
 300 BROADWAY, SUITE 1100, NEW YORK, NY 10013


DOOR SCHEDULE & DETAILS

REVISIONS

NO.	DATE	DESCRIPTION
1	01/15/2024	ISSUED FOR PERMIT
2	02/15/2024	ISSUED FOR PERMIT
3	03/15/2024	ISSUED FOR PERMIT
4	04/15/2024	ISSUED FOR PERMIT
5	05/15/2024	ISSUED FOR PERMIT







A1.1





MCWCB ARCHITECTS ■ 300 INDEPENDENCE AVENUE, SUITE 1200P 400 WEST 50TH STREET, MIAMI BEACH, FL 33130 TEL: 305.441.1111 FAX: 305.441.1112 WWW.MCWCBARCHITECTS.COM	CONTRACT NO. PROJECT: VIOLET BANK MUSEUM PHASE II - EXTERIOR RESTORATION 300 MIAMI AVENUE, COLOMBIA HEIGHTS, VA 22004	SOUTH ELEVATIONS	
DATE: 04/10/2024 COMPILED BY: [Signature] DRAWN BY: [Signature] DATE: MAY 14, 2025	A3.0 DRAWING NO.		

[illegible]



ARCHITECTS
100 DAY AUBURN, NY 12207
SUSSEX STREET, WILLIAMSBURG, VA
23185
WWW.ANCWS-ARCH.COM

MCW D
300 BROAD
400 W DUFFIE ST
518.433.9946

CONSULTANTS
LLC
WWW.MCW.COM

STRUCTURAL ENGINEER
90% FORTNIGHTLY PAY
225 H 5014 STREET
674.302.8801 | 674.302.8802

CONTACT INFORMATION

NET BANK MUSEUM
EXTERIOR RESTORATION
c/o Colmored Holdings, VA 23034

PROJECT	VIOLIN PHASE II - E 303 Virginia Ave
---------	--



01900025

CRAIG D. SWIFT
Lic. No. 56121

FLORIDA
PROFESSIONAL ENGINEER

REVISIONS

NO.	DESCRIPTION	DATE
1	CONSTRUCTION	05.11.20
	DRAWINGS	

SCALE
AS NOTED

COMMISSION INCL.

2410


DRAWN BY
SD

DATE
05.19.2025

ETE

S0.0

DRAWING NO.

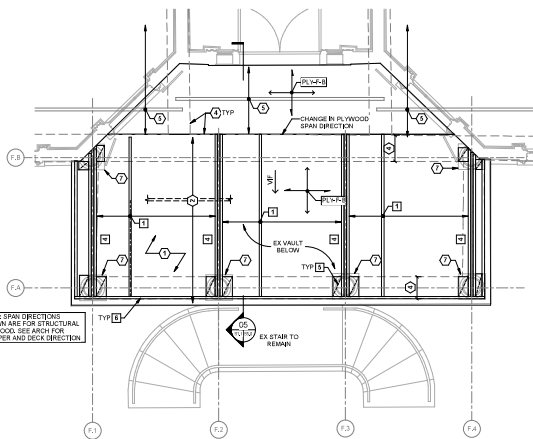


01
02.5 ENLARGED STRUCTURAL PLAN
3/8" = 1'-0"

SELECTIVE REMOVALS NOTES

- 1 REMOVE EXISTING PORCH DECKING
- 2 REMOVE EXISTING PORCH SLEEPERS
- 3 SHORE EX ROOF STRUCTURE ABOVE, DEMOLISH EXISTING PORCH COLUMN AND REPLACE W/ NEW, COORD W/ ARCH AND NEW WORK
- 4 UNLESS NOTED OTHERWISE, EXISTING MASONRY FOUNDATION WALL TO REMAIN
- 5 AFTER DECKING IS REMOVED, NOTIFY A/E FOR REVIEW OF EXISTING JOIST FRAMING CONDITION, DETERMINE INDICIS FURTHER REPAIR WORK MAY BE REQUIRED
- 6 REMOVE EXISTING WOOD RAILING, COORDINATE WITH ARCH
- 7 SHORE EX ROOF STRUCTURE ABOVE, CAREFULLY REMOVE EXISTING COLUMNS & PLASTERS AND REPAIR PER ARCH. REINSTALL AFTER NEW DECKING IS INSTALLED, COORDINATE WITH ARCH.

NEW WORK NOTES

- 1 PRESERVATIVELY TREATED 1 1/4" LVL JOIST AT 16" O.C. RIP TOP OF JOIST TO DECK SLOPE, MIN. SECTION DEPTH 7 1/4". NOTIFY A/E IF OTHERWISE.
- 2 NEW PT 6X6 COLUMN, INSTALL SQUASH BLOCKS, SLEEPERS, & BLOCKING DIRECTLY BELOW NEW COLUMN PRIOR TO DECKING. INSTALL PER NOTE 5.A. AT TOP OF COL. INSTALL 2x8x8x12x12 POST. (A) 1" ESB SCREWS THROUGH WOOD SHEATHING AND (A) 1" ESB SCREWS INTO POST. TOP OF STANCHION POST BELOW POST. SET TIGHT TO UNDERSIDE OF EX BEAM. FASTEN TOP OF COL TO EX BEAM W/ MIN (3) 1/2" COMMON NAILS. FLOOR IN AT ANGLE.
- 3 NEW EXTERIOR TREATED PLYWOOD SHEATHING WITH PT SLEEPERS AND NEW DECKING. SEE SHEATHING SCHEDS AND COORD W/ ARCH
- 4 (A) PLY LVL JOIST AT COLUMN AND PLASTER LOCATIONS
- 5 INSTALL ADDITIONAL PT SQUASH BLOCKS, BLOCKING AND SLEEPERS BELOW COLUMNS, PLASTERS, & RAILING POSTS
- 6 CONTRADIS PRESERVATIVELY TREATED 1/4" RM BOARD, RIP TOP TO SLOPE AT PORCH SIDE RM BOARD.

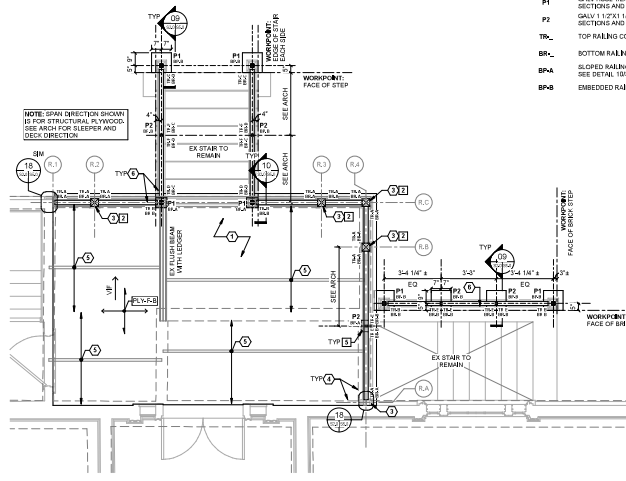

02
02.5 ENLARGED STRUCTURAL PLAN
3/8" = 1'-0"

PLAN SYMBOLS

- C CENTERLINE
- PLYWOOD PRESERVATIVELY TREATED 3/4" PLYWOOD SHEATHING, EXTERIOR RATED, SUITABLE FOR OUTDOOR USE. SEE SCHEDS ON SHEET 03.5. GALV. HESK-12X3-12 IN RAILING POST, CONNECTIONS VARY. SEE SECTIONS AND TYPICAL DETAILS FOR ADDITIONAL INFORMATION.
- P1 GALV. HESK-12X3-12 IN RAILING POST, CONNECTIONS VARY. SEE SECTIONS AND TYPICAL DETAILS FOR ADDITIONAL INFORMATION.
- P2 GALV. 1 1/2 X 1 1/2 OF BAR RAILING POST, CONNECTIONS VARY. SEE SECTIONS AND TYPICAL DETAILS FOR ADDITIONAL INFORMATION.
- TR TOP RAILING CONNECTION, SEE DETAIL 1005.0.
- BR-1 BOTTOM RAILING CONNECTION, SEE DETAIL 1005.0.
- BR-2 SLOPED RAILING POST BASE PLATE CONNECTION, SEE DETAIL 1005.0.
- BR-3 EMBEDDED RAILING POST CONNECTION, SEE DETAIL 0805.0.

